

SERVICE ADVISORY

NO.: 20140 Rev B

TO: GTN Xi Owners and Operators
DATE: January 12, 2021
SUBJECT: ADS-B Out Not Functioning
REVISION B: Added Resolution

PRODUCTS AFFECTED

GTN Xi products with main software version 20.10 installed with a GTX 33ES, 330ES, 335(D), 335(D)R, 345(D), or 345(D)R with transponder controls on the GTN Xi are affected.

ISSUE

The GTN Xi is sending erroneous ADS-B OUT data.

ACTION

Be aware the ADS-B OUT data is erroneous, and your system is not ADS-B compliant.

For GTX 33ES, 330ES, 335(D) and 335(D)R installations, contact your dealer to revert to GTN Xi main software version 20.01.

For GTX 345(D) and GTX 345(D)R installations, contact your dealer to revert to GTN Xi main software version 20.01 or a possible configuration change.

RESOLUTION

This issue has been corrected in GTN Xi Main Software Version 20.11. Refer to Garmin TSO Service Bulletin 2102.