



1200 E. 151st Street
Olathe, KS 66062
913-397-8200

AVIATION SERVICE DOCUMENT NOTIFICATION

TO: GI 275 Owner and Operators
DATE: January 27, 2023
SUBJECT: GI 275 Multi-function Instrument Software Version 2.60
CERTIFICATION AUTHORIZATION: STC SA02658SE

COMPLIANCE

Optional: STC Service Bulletin 23003 may be incorporated at the owner's discretion.

PURPOSE

This STC Service Bulletin provides notification of STC SA02658SE Master Drawing List revision 19. This update includes the following changes:

- Updated GI 275 System Software to version 2.60:



NOTE

If installed, GTN Xi Software Version 20.30 (or later) and TXi 3.50 Software Version (or later) is required before loading GI 275 Software Version 2.60.



NOTE

Database sync routing is affected by this change. Systems with GTN™ 6XX/7XX (v6.72 or earlier) or GPS 175/GNC® 355/GNX™ 375 (v3.20 or earlier) interfaced to G500/G600 TXi (v3.50 or later) or GI 275 (v2.60 or later) no longer support database sync. Databases will need to be loaded onto each GTN 6XX/7XX and GPS 175/GNC 355/GNX 375 unit. This limitation will be fixed in future GTN 6XX/7XX and GPS 175/GNC 355/GNX 375 software versions.

Please contact your local Garmin Avionics Dealer (<http://www.garmin.com/dealers/>) for additional information or for questions regarding this notification. This service notification and associated bulletin/advisory product changes can only be implemented through Garmin's authorized dealer and service center network. This document is not a substitute for and cannot be used in lieu of the document(s) referenced above for airworthiness approval.



1200 E. 151st Street
Olathe, KS 66062
913-397-8200

- Fixed the Automatic Pitch Trim issue described in Garmin Service Alert 22109 with:
GSA28, System Software Version 4.95 (or later)
GSA28 -2X, System Software Version 2.25 (or later)



NOTE

Refer to Garmin STC Service Bulletin 22123 for a complete list of minimum software versions to update the GFC 500 software.

- Added the Miscellaneous Fields display to the HSI and HSI map pages
- Improved the Bluetooth output data with various GPS sources
- Added 'No Coverage' to the various FIS-B product legends
- Added Density Altitude as a selectable field on the MFD Data page
- Improved the user experience for airspace information on the moving map page
- Added digitally signed database application
- Improved flight data logging and diagnostics
- Updated GMU 44B System Software to version 2.01



NOTE

This update was limited to software robustness and has no functional effect

- Added the EPIC E1000 model to the AML

PRODUCTS AFFECTED

GI 275 Multi-function Instrument systems installed under the GI 275 Part 23 AML STC SA02658SE are affected.

Please contact your local Garmin Avionics Dealer (<http://www.garmin.com/dealers/>) for additional information or for questions regarding this notification. This service notification and associated bulletin/advisory product changes can only be implemented through Garmin's authorized dealer and service center network. This document is not a substitute for and cannot be used in lieu of the document(s) referenced above for airworthiness approval.