



1200 E. 151st Street
Olathe, KS 66062
913-397-8200

SERVICE ADVISORY

NO.: 23033 Rev C

TO: Garmin GTX™ 345/345R/345D/345DR/45R, GDL® 88(H)/84(H), GNX™ 375, GTS™ 800/820/850, and GTS 825/855/8000 Owners and Operators

DATE: February 20, 2024

SUBJECT: ADS-B In Surface Targets

REVISION C: Corrected Product Affected

PRODUCTS AFFECTED

GTX 345/345R/345D/345DR/45R, GDL 88(H)/84(H), GNX 375, GTS 800/820/850, and GTS 825/855/8000 units (with software listed in Table 1) using ADS-B IN are affected.

Table 1 Product Affected

| Unit | Software Versions |
|-----------------------------|--|
| GTX 345/345R/345D/345DR/45R | ADS-B 2.00 through 3.31 (except 3.15) and 3.40 |
| GDL 88(H)/84(H) | 3.00 through 3.42 |
| GNX 375 | Main 2.00 through 3.20 |
| GTS 800/820/850 | 5.00 and 5.01 |
| GTS 825/855/8000 | 4.00 through 4.04 (except 4.03.1) |

© 2024 Garmin Ltd. or its subsidiaries.

This work is licensed under a
[Creative Commons Attribution-NonCommercial-NoDerivs 3.0 Unported License](https://creativecommons.org/licenses/by-nc-nd/3.0/)..

ISSUE

Slow-moving (less than 20 knots) 1090ES ADS-B and ADS-R surface targets may erroneously appear as directional. Figure 1 shows an example traffic display with both slow-moving directional and non-directional surface traffic. The selected surface target is erroneously shown with a directional symbol while the surface target near the top is correctly shown with a non-directional symbol (diamond).



NOTE

Airborne and UAT targets are not affected.



Figure 1 - Example Traffic Display

PILOT ACTION

Be aware that directionality of slow-moving (less than 20 knots) ADS-B In surface targets may be shown erroneously.



NOTE

The ADS-B SURF traffic display is to be used only to supplement what can be seen out the window (AC 90-114B section 2.4.3).

RESOLUTION

Refer to Table 2.

Table 2 Resolution

| Unit | Corrected Software Versions |
|-----------------------------|--|
| GTX 345DR | ADS-B 3.32 (Garmin TSO Service Bulletin 23042) |
| GTX 345/345R/345D/345DR/45R | ADS-B 3.41 (Garmin TSO Service Bulletin 23031) |
| GTX 345/345R/345D/345DR/45R | ADS-B 3.15 |
| GNX 375 | Main 3.21 (Garmin TSO Service Bulletin 23037) |
| GTS 825/855/8000 | 4.03.1 4.05 (Garmin TSO Service Bulletin 24010) |
| GTS 800/820/850 | 5.02 |
| GDL 84(H)/88(H) | 3.43 (Garmin TSO Service Bulletin 23056) |