

1200 E. 151st Street Olathe, KS 66062 913-397-8200

AVIATION SERVICE DOCUMENT NOTIFICATION

TO: GTN[™] Xi and GTN 6XX/7XX Owners and Operators

DATE: August 1, 2023

SUBJECT: Approval of GTN 6XX/7XX Software Version 6.73 and

GTN Xi Software Version 20.31

CERTIFICATION

AUTHORIZATION: SR02120SE MDL Revision 13

COMPLIANCE

<u>Recommended:</u> For GTN 6XX/7XX products, compliance with STC Service Bulletin 23078 is recommended at the next service interval.

<u>Optional:</u> For GTN Xi products, compliance with STC Service Bulletin 23078 is optional and may be incorporated at the owner's discretion.

PURPOSE

This STC Service Bulletin provides notification of an update to STC SR02120SE MDL Revision 13. Major details of the update are:

- Updated GTN 6XX/7XX main software to Software Version 6.73:
 - Fixed an issue with importing flight plans from a PED.
 - Fixed an issue related to flight plan export to a PED. Changing the active leg will now trigger the flight plan to export.
 - Fixed an issue to prevent unintended changing of the active frequency to the emergency frequency on a power cycle.
 - Fixed an issue where a Low Battery system message was annunciated when GPS reported invalid data/time.
 - Fixed an issue so VOR approach navigation is not aborted with loss of GPS navigation
 - Made improvements to loading a Hold-In-Lieu-of-Procedure Turn (HILPT) as part of an approach by removing additional waypoints that were included between the hold leg and the following hold fix leg.
 - Fixed a database sync issue with G500H TXi (v3.50) and GI 275 (v2.60). Databases will now sync properly with G500H and GI 275 units.
 - Fixed an issue where the OBS mode could be activated between the FAF and MAP using the OBS Mode Select discrete input.
 - Fixed an issue described in Garmin Service Advisory 2185, where loading a GPS-based approach before the system has determined a valid GPS position may result in the system aborting the approach in areas without SBAS or for systems that have SBAS disabled.

Please contact your local Garmin Avionics Dealer (http://www.garmin.com/dealers/) for additional information or for questions regarding this notification. This service notification and associated bulletin/advisory product changes can only be implemented through Garmin's authorized dealer and service center network. This document is not a substitute for and cannot be used in lieu of the document(s) referenced above for airworthiness approval.



1200 E. 151st Street Olathe, KS 66062 913-397-8200

- Updated GTN Xi main software to Software Version 20.31:
 - Fixed an issue so the display of NAV angle values on the flight plan page matches the pilot selected NAV units.
 - Fixed an issue to display the Mute Alert button on the ADS-B Traffic page and Alert popup.
 - Improved Database SYNC system message so it clears after viewing.
 - Fixed an issue where a database transfer status would indicate one hundred percent complete when a database transfer had failed.
 - Expanded database information page to include FliteChart and SafeTaxi® database region information.
 - Fixed an issue where a Low Battery system message was annunciated when GPS reported invalid data/time.
 - Made an improvement to the Connext® setup page, so GTX™ icon is removed when Bluetooth is disabled on the GTX.

PRODUCTS AFFECTED

GTN 6XX/7XX and GTN Xi systems installed in accordance with STC SR02120SE are affected.

WARRANTY INFORMATION

For GTN 6XX/7XX installations, this modification is warranty reimbursable with a deadline of January 31, 2024.

For GTN Xi installations, this modification is not warranty reimbursable.

Please contact your local Garmin Avionics Dealer (http://www.garmin.com/dealers/) for additional information or for questions regarding this notification. This service notification and associated bulletin/advisory product changes can only be implemented through Garmin's authorized dealer and service center network. This document is not a substitute for and cannot be used in lieu of the document(s) referenced above for airworthiness approval.