



# SERVICE ADVISORY

NO.: 0837

**TO:** All Garmin Aviation Service Centers  
**DATE:** October 27, 2008  
**SUBJECT:** G600 NAV/ILS Glideslope Display and GPS signal


---

## AFFECTED PRODUCTS

All G600 units are affected

## DESCRIPTION

In GDU 620 version 2.01 software, ILS glideslope information will only be displayed if the GDU 620 has valid GPS position information. On the PFD, glideslope information is displayed immediately to the left of the VSI indicator, as shown below. The display of localizer information is not affected.

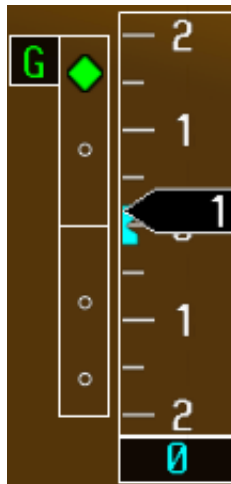

**LOC/ILS is the selected navigation source**

## RESOLUTION

A future software version will address this issue where the GDU 620 will not require valid GPS position in order to display ILS glideslope information.

© Copyright 2008  
Garmin Ltd. or its subsidiaries  
All Rights Reserved

Except as expressly provided herein, no part of this document may be reproduced, copied, transmitted, disseminated, downloaded or stored in any storage medium, for any purpose without the express prior written consent of Garmin. Garmin hereby grants permission to download a single copy of this document and of any revision to this document onto a hard drive or other electronic storage medium to be viewed and to print one copy of this document or of any revision hereto, provided that such electronic or printed copy of this document or revision must contain the complete text of this copyright notice and provided further that any unauthorized commercial distribution of this document or any revision hereto is strictly prohibited.